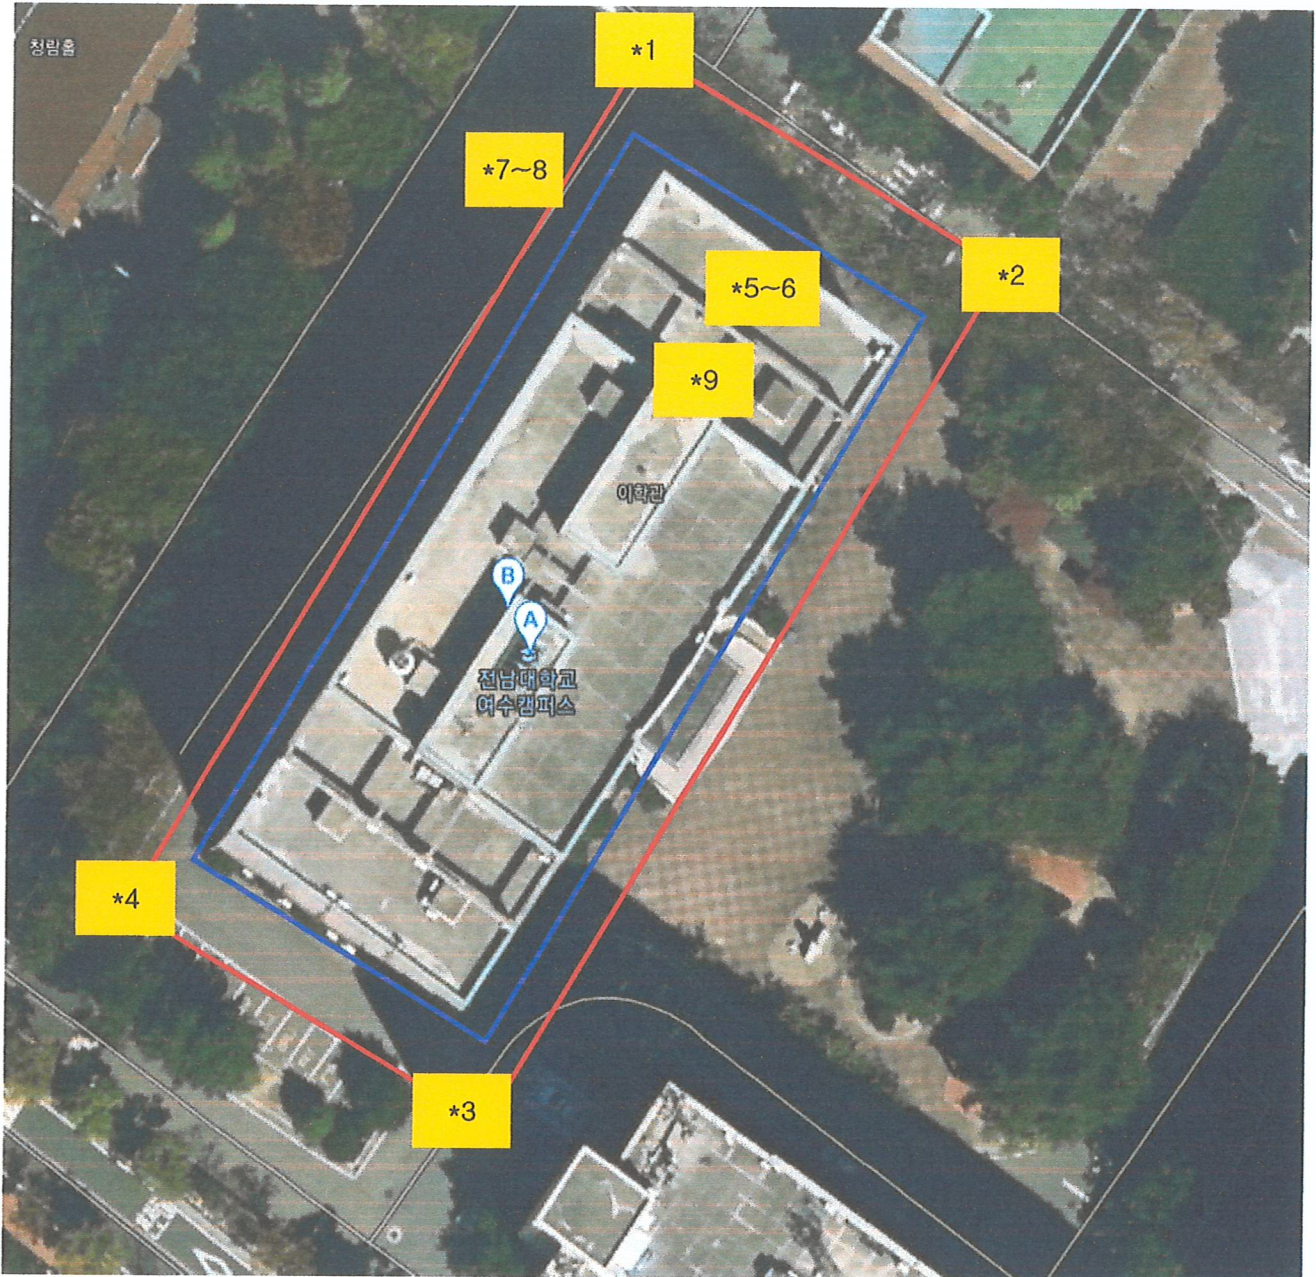


[별첨1] 측정 위치도(측정 장소)

제1공학관 외 3동 석면철거공사 <이학관>

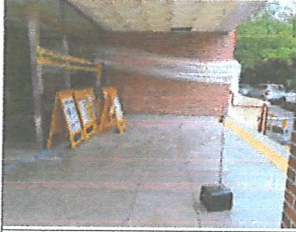



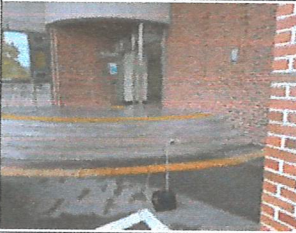


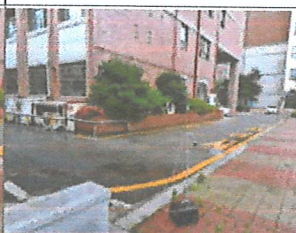







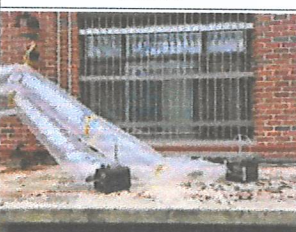


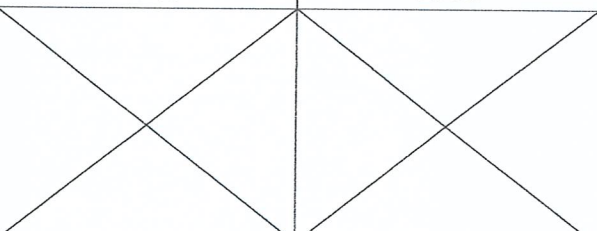


범례	*NO		
	시료채취	부지경계선	해당건물

[별첨2] 측정 결과

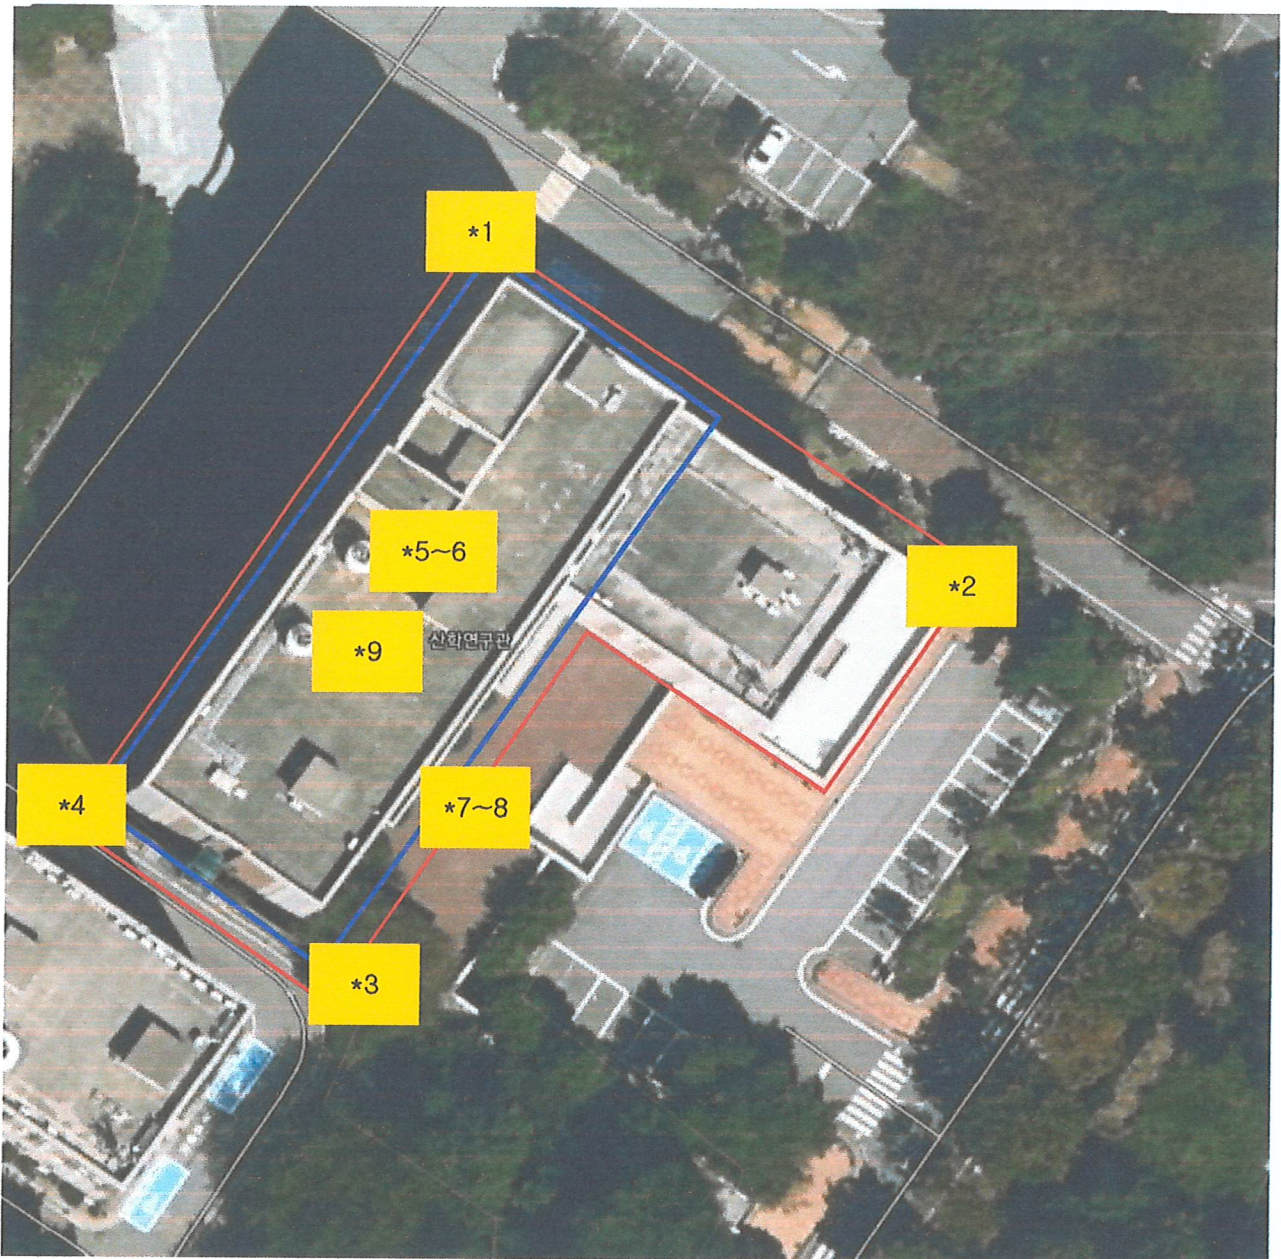
시료 번호	측정 지점	측정 장비 (종류/수량)		유량 (ℓ/분)	측정 일시	측정 결과 (f/cc)	비고
1	부지경계선1	지역시료채취펌프 (SARA-5100)	1	10.00	20/06/18	불검출 [검출한계 0.002미만]	—
2	부지경계선2	지역시료채취펌프 (SARA-5100)	1	10.00	20/06/18	불검출 [검출한계 0.002미만]	—
3	부지경계선3	지역시료채취펌프 (SARA-5100)	1	10.00	20/06/18	불검출 [검출한계 0.002미만]	—
4	부지경계선4	지역시료채취펌프 (SARA-5100)	1	10.00	20/06/18	불검출 [검출한계 0.002미만]	—
5	위생설비입구	지역시료채취펌프 (SARA-5100)	1	10.00	20/06/18	불검출 [검출한계 0.002미만]	—
6	작업장주변	지역시료채취펌프 (SARA-5100)	1	10.00	20/06/18	불검출 [검출한계 0.002미만]	—
7	음압기배출구1	지역시료채취펌프 (SARA-5100)	1	10.00	20/06/18	불검출 [검출한계 0.002미만]	—
8	음압기배출구2	지역시료채취펌프 (SARA-5100)	1	10.00	20/06/18	불검출 [검출한계 0.002미만]	—
9	폐기물반출구	지역시료채취펌프 (SARA-5100)	1	10.00	20/06/18	불검출 [검출한계 0.002미만]	—
—	공시료	—	—	—	—	0개/100개시야	—
—	공시료	—	—	—	—	0개/100개시야	—



[별첨3] 측정 사진

측정 지점	시작 사진/시간	종료 사진/시간	시작 사진/시간	종료 사진/시간
부지경계선1,2	 12:00	 16:00	 12:02	 16:02
부지경계선3,4	 12:05	 16:05	 12:07	 16:07
위생설비입구/ 작업장주변	 12:15	 12:55	 12:20	 14:20
음압기배출구1,2	 12:40	 13:20	 12:40	 13:20
폐기물반출구	 13:10	 13:50		

[별 첨 1] 측정 위치도(측정 장소)

제1공학관 외 3동 석면철거공사 <산학연구원>





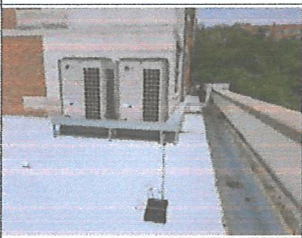
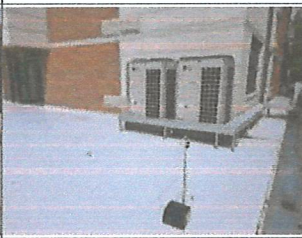
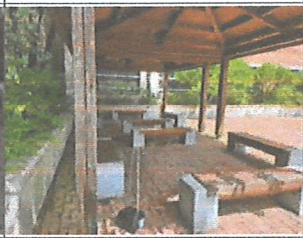
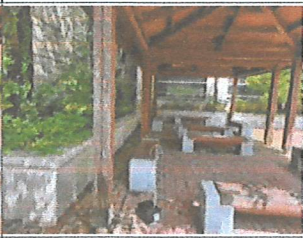
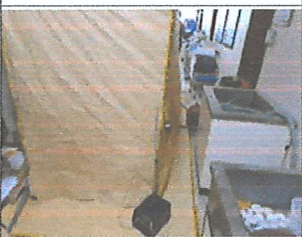
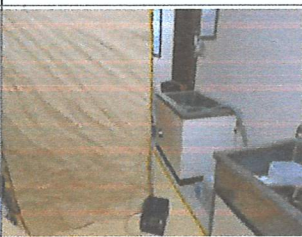
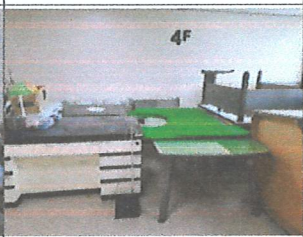







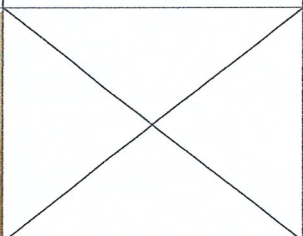
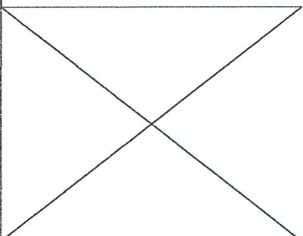


범 례	*NO		
	시료채취	부지경계선	해당건물

[별첨2] 측정 결과

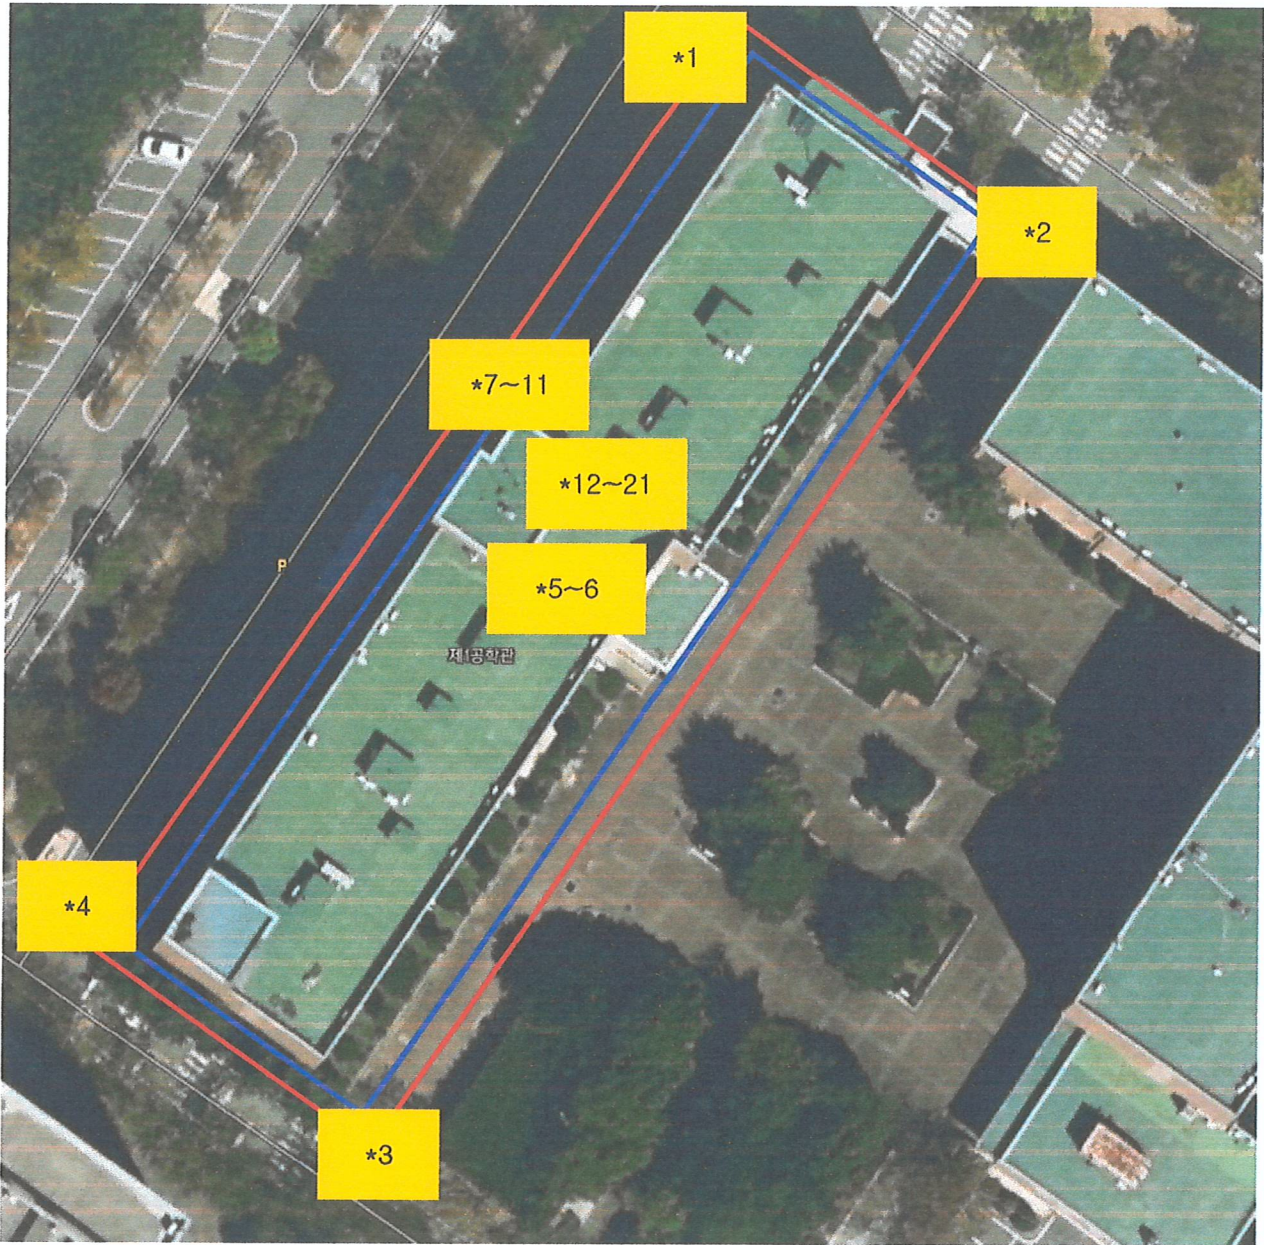
시료 번호	측정 지점	측정 장비 (종류/수량)		유량 (ℓ/분)	측정 일시	측정 결과 (f/cc)	비고
1	부지경계선1	지역시료채취펌프 (SARA-5100)	1	10.00	20/06/19	불검출 [검출한계 0.002미만]	-
2	부지경계선2	지역시료채취펌프 (SARA-5100)	1	10.00	20/06/19	불검출 [검출한계 0.002미만]	-
3	부지경계선3	지역시료채취펌프 (SARA-5100)	1	10.00	20/06/19	불검출 [검출한계 0.002미만]	-
4	부지경계선4	지역시료채취펌프 (SARA-5100)	1	10.00	20/06/19	불검출 [검출한계 0.002미만]	-
5	위생설비입구	지역시료채취펌프 (SARA-5100)	1	10.00	20/06/19	불검출 [검출한계 0.002미만]	-
6	작업장주변	지역시료채취펌프 (SARA-5100)	1	10.00	20/06/19	불검출 [검출한계 0.002미만]	-
7	음압기배출구1	지역시료채취펌프 (SARA-5100)	1	10.00	20/06/19	불검출 [검출한계 0.002미만]	-
8	음압기배출구2	지역시료채취펌프 (SARA-5100)	1	10.00	20/06/19	불검출 [검출한계 0.002미만]	-
9	폐기물반출구	지역시료채취펌프 (SARA-5100)	1	10.00	20/06/19	불검출 [검출한계 0.002미만]	-
-	공시료	-	-	-	-	0개/100개시야	-
-	공시료	-	-	-	-	0개/100개시야	-



[별첨3] 측정 사진

측정 지점	시작 사진/시간	종료 사진/시간	시작 사진/시간	종료 사진/시간
부지경계선1,2	 9:30	 13:30	 9:35	 13:35
부지경계선3,4	 9:40	 13:40	 9:45	 13:45
위생설비입구/ 작업장주변	 9:52	 10:32	 9:55	 11:55
음압기배출구1,2	 10:20	 11:00	 10:22	 11:02
폐기물반출구	 11:00	 11:40	 -	 -

[별 첨1] 측정 위치도(측정 장소)

제1공학관 외 3동 석면철거공사 <제1공학관>






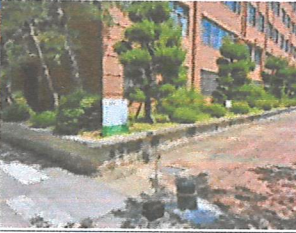

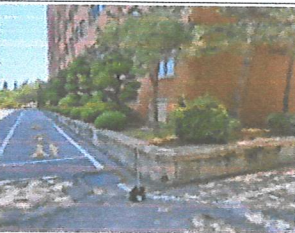



















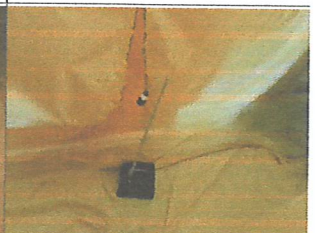

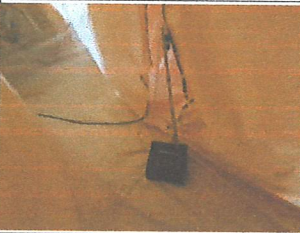
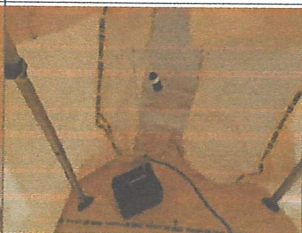
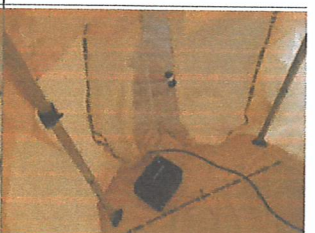
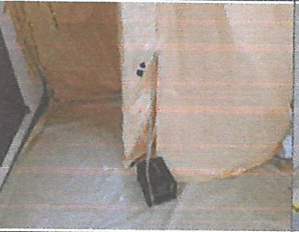



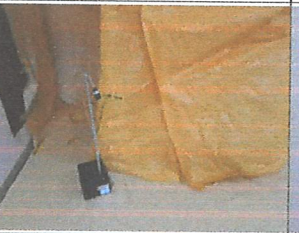



범 례	*NO		
	시료채취	부지경계선	해당건물



[별첨2] 측정 결과

시료 번호	측정 지점	측정 장비 (종류/수량)		유량 (ℓ/분)	측정 일시	측정 결과 (f/cc)	비고
1	부지경계선1	지역시료채취펌프 (SARA-5100)	1	10.00	20/06/21	불검출 [검출한계 0.002미만]	—
2	부지경계선2	지역시료채취펌프 (SARA-5100)	1	10.00	20/06/21	불검출 [검출한계 0.002미만]	—
3	부지경계선3	지역시료채취펌프 (SARA-5100)	1	10.00	20/06/21	불검출 [검출한계 0.002미만]	—
4	부지경계선4	지역시료채취펌프 (SARA-5100)	1	10.00	20/06/21	불검출 [검출한계 0.002미만]	—
5	위생설비입구	지역시료채취펌프 (SARA-5100)	1	10.00	20/06/21	불검출 [검출한계 0.002미만]	—
6	작업장주변	지역시료채취펌프 (SARA-5100)	1	10.00	20/06/21	불검출 [검출한계 0.002미만]	—
7	음압기배출구1	지역시료채취펌프 (SARA-5100)	1	10.00	20/06/21	불검출 [검출한계 0.002미만]	—
8	음압기배출구2	지역시료채취펌프 (SARA-5100)	1	10.00	20/06/21	불검출 [검출한계 0.002미만]	—
9	음압기배출구3	지역시료채취펌프 (SARA-5100)	1	10.00	20/06/21	불검출 [검출한계 0.002미만]	—
10	음압기배출구4	지역시료채취펌프 (SARA-5100)	1	10.00	20/06/21	불검출 [검출한계 0.002미만]	—
11	음압기배출구5	지역시료채취펌프 (SARA-5100)	1	10.00	20/06/21	불검출 [검출한계 0.002미만]	—
12	폐기물반출구1	지역시료채취펌프 (SARA-5100)	1	10.00	20/06/21	불검출 [검출한계 0.002미만]	—
13	폐기물반출구2	지역시료채취펌프 (SARA-5100)	1	10.00	20/06/21	불검출 [검출한계 0.002미만]	—
14	폐기물반출구3	지역시료채취펌프 (SARA-5100)	1	10.00	20/06/21	0.003	—
15	폐기물반출구4	지역시료채취펌프 (SARA-5100)	1	10.00	20/06/21	불검출 [검출한계 0.002미만]	—
16	폐기물반출구5	지역시료채취펌프 (SARA-5100)	1	10.00	20/06/21	0.003	—
17	갱의실1	지역시료채취펌프 (SARA-5100)	1	10.00	20/06/21	불검출 [검출한계 0.002미만]	—
18	갱의실2	지역시료채취펌프 (SARA-5100)	1	10.00	20/06/21	불검출 [검출한계 0.002미만]	—
19	갱의실3	지역시료채취펌프 (SARA-5100)	1	10.00	20/06/21	불검출 [검출한계 0.002미만]	—
20	갱의실4	지역시료채취펌프 (SARA-5100)	1	10.00	20/06/21	불검출 [검출한계 0.002미만]	—
21	갱의실5	지역시료채취펌프 (SARA-5100)	1	10.00	20/06/21	불검출 [검출한계 0.002미만]	—
—	공시료	—	—	—	—	0개 / 100개시야	—
—	공시료	—	—	—	—	0개 / 100개시야	—

[별첨3] 측정 사진

측정 지점	시작 사진/시간	종료 사진/시간	시작 사진/시간	종료 사진/시간
부지경계선1,2	 9:00	 13:00	 9:05	 13:05
부지경계선3,4	 9:10	 13:10	 9:15	 13:15
위생설비입구/ 작업장주변	 9:20	 10:00	 9:25	 11:25
응압기배출구1,2	 9:35	 10:15	 9:37	 10:17
응압기배출구3,4	 9:40	 10:20	 9:42	 10:22

측정 지점	시작 사진/시간	종료 사진/시간	시작 사진/시간	종료 사진/시간
음압기배출구5/ 폐기물반출구1				
	9:45	10:25	10:00	10:40
폐기물반출구2,3				
	10:40	11:20	11:30	12:10
폐기물반출구4,5				
	13:00	13:40	13:40	14:20
갱의실1,2				
	10:30	11:10	10:35	11:15
갱의실3,4				
	10:45	11:25	10:50	11:30

측정 지점	시작 사진/시간	종료 사진/시간	시작 사진/시간	종료 사진/시간
갱의실5				
	10:55	11:35	-	-