

[별 첨1] 측정 위치도(측정 장소)

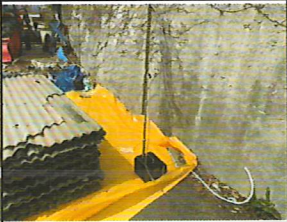
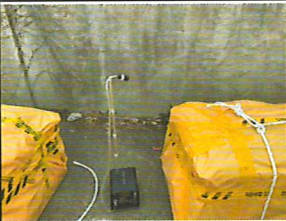
소제지구 택지개발공사 중 석면철거공사		측정일시	22.3.21
			
범 례	*NO		
	시료채취	부지경계선	대상건축물

[별첨2] 측정 결과 (측정일시 22.3.21)

[illegible]

[별첨3] 측정 사진 (측정일시 22.3.21)

측정 지점	시작 사진	종료 사진	시작 사진	종료 사진
부지경계선 1,2				
	8:40	12:50	8:45	12:55
부지경계선 3,4				
	8:50	13:00	8:55	13:05
위생설비입구 1,2				
	9:10	9:55	10:00	10:45
작업장주변 1,2				
	9:15	11:25	10:10	12:20
작업장주변3 / 거주자 주거지역1				
	13:20	15:30	10:30	12:40
거주자 주거지역2 / 폐기물반출구1				
	10:40	12:50	9:30	10:15

측정 지점	시작 사진	종료 사진	시작 사진	종료 사진
폐기물반출구 2,3				
	11:00	11:45	13:30	14:15
폐기물 보관지점1,2				
	13:00	13:45	15:00	15:45

[별첨1] 측정 위치도(측정 장소)

소제지구 택지개발공사 중 석면철거공사		측정일시	22.3.22
범례	*NO		
	시료채취	부지경계선	대상건축물

소제지구 택지개발공사 중 석면철거공사

측정일시

22.3.22



범 례

*NO
시료채
취


부지경계선

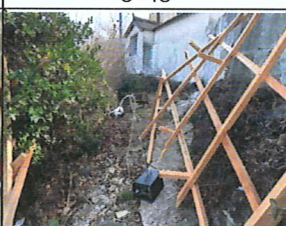
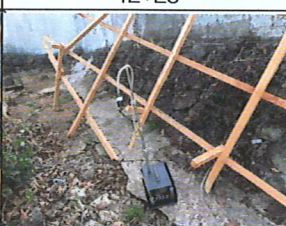
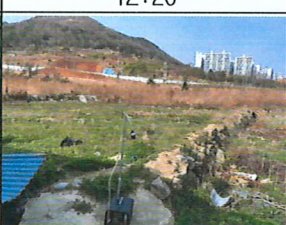
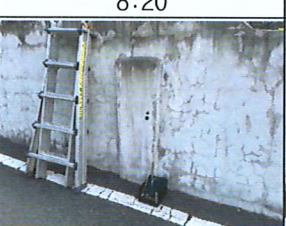
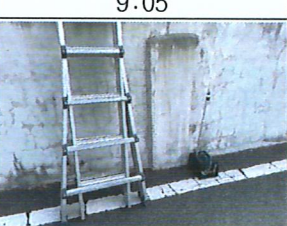
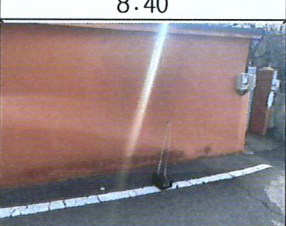
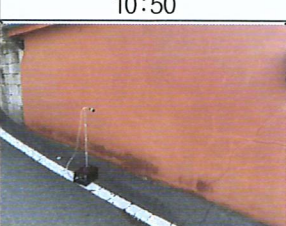

대상건축물

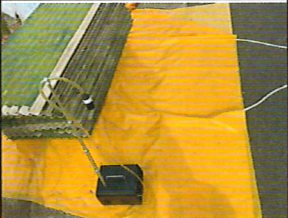
[별첨2] 측정 결과

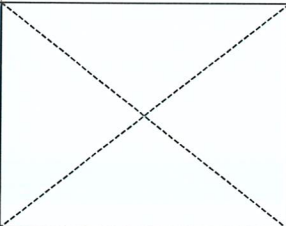
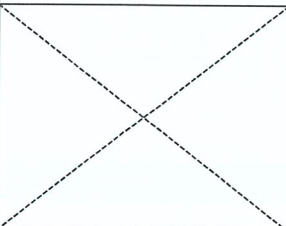
시료 번호	측정 지점	측정 장비 (종류/수량)		유량 (ℓ/분)	측정 일시	측정 결과 (f/cc)	비고
*1	부지경계선1	지역시료채취펌프 SARA-5100	1	9.74	22/03/22	불검출[검출한계 0.002미만]	-
*2	부지경계선2	지역시료채취펌프 SARA-5100	1	9.70	22/03/22	불검출[검출한계 0.002미만]	-
*3	부지경계선3	지역시료채취펌프 SARA-5100	1	9.72	22/03/22	불검출[검출한계 0.002미만]	-
*4	부지경계선4	지역시료채취펌프 SARA-5100	1	9.98	22/03/22	불검출[검출한계 0.002미만]	-
*5	부지경계선5	지역시료채취펌프 SARA-5100	1	9.73	22/03/22	불검출[검출한계 0.002미만]	-
*6	부지경계선6	지역시료채취펌프 SARA-5100	1	9.74	22/03/22	불검출[검출한계 0.002미만]	-
*7	부지경계선7	지역시료채취펌프 SARA-5100	1	9.90	22/03/22	불검출[검출한계 0.002미만]	-
*8	부지경계선8	지역시료채취펌프 SARA-5100	1	9.94	22/03/22	불검출[검출한계 0.002미만]	-
*9	위생설비입구	지역시료채취펌프 SARA-5100	1	9.69	22/03/22	불검출[검출한계 0.002미만]	-
*10	작업장주변1	지역시료채취펌프 SARA-5100	1	9.62	22/03/22	불검출[검출한계 0.002미만]	-
*11	작업장주변2	지역시료채취펌프 SARA-5100	1	9.75	22/03/22	불검출[검출한계 0.002미만]	-
*12	작업장주변3	지역시료채취펌프 SARA-5100	1	9.78	22/03/22	불검출[검출한계 0.002미만]	-
*13	작업장주변4	지역시료채취펌프 SARA-5100	1	9.57	22/03/22	불검출[검출한계 0.002미만]	-
*14	작업장주변5	지역시료채취펌프 SARA-5100	1	9.72	22/03/22	불검출[검출한계 0.002미만]	-
*15	작업장주변6	지역시료채취펌프 SARA-5100	1	9.71	22/03/22	불검출[검출한계 0.002미만]	-
*16	거주자주거지역1	지역시료채취펌프 SARA-5100	1	9.67	22/03/22	불검출[검출한계 0.002미만]	-
*17	거주자주거지역2	지역시료채취펌프 SARA-5100	1	9.96	22/03/22	불검출[검출한계 0.002미만]	-
*18	폐기물반출구1	지역시료채취펌프 SARA-5100	1	9.85	22/03/22	불검출[검출한계 0.002미만]	-
*19	폐기물반출구2	지역시료채취펌프 SARA-5100	1	9.95	22/03/22	불검출[검출한계 0.002미만]	-
*20	폐기물반출구3	지역시료채취펌프 SARA-5100	1	9.52	22/03/22	불검출[검출한계 0.002미만]	-

[illegible]

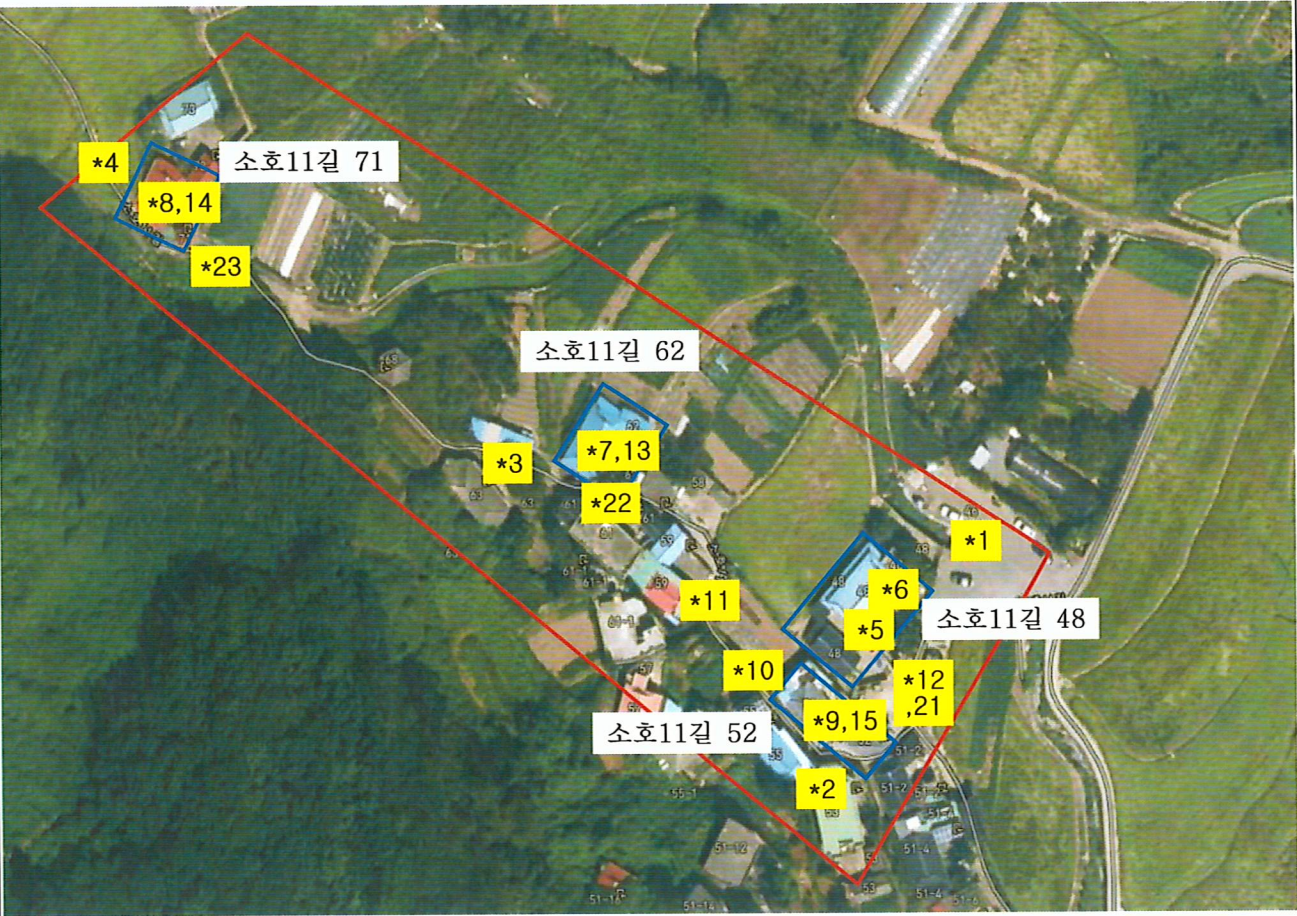
[별첨3] 측정 사진 (측정일시 22.3.22)

측정 지점	시작 사진	종료 사진	시작 사진	종료 사진
부지경계선 1,2				
	8:00	12:10	8:05	12:15
부지경계선 3,4				
	8:10	12:20	8:15	12:25
부지경계선 5,6				
	12:15	16:25	12:20	16:30
부지경계선 7,8				
	12:25	16:35	12:30	16:40
위생설비입구 / 작업장주변1				
	8:20	9:05	8:40	10:50
작업장주변 2,3				
	9:00	11:10	10:15	12:25

측정 지점	시작 사진	종료 사진	시작 사진	종료 사진
작업장주변 4,5				
	13:00	15:10	13:30	15:40
작업장주변6 / 거주자 주거지역1				
	14:00	16:10	11:00	13:10
거주자 주거지역2 / / 폐기물반출구1				
	11:20	13:30	8:45	9:30
폐기물반출구 2,3				
	9:15	10:00	10:30	11:15
폐기물 보관지점1,2				
	7:30	8:15	7:35	8:20
폐기물 보관지점3,4				
	11:00	11:45	11:30	12:15

측정 지점	시작 사진	종료 사진	시작 사진	종료 사진
폐기물 보관지점5				
	12:00	12:45	-	-

[별첨1] 측정 위치도(측정 장소)

소제지구 택지개발공사 중 석면철거공사		측정일시	22.3.23
			
범례	*NO		
	시료채취	부지경계선	대상건축물

소제지구 택지개발공사 중 석면철거공사

측정일시

22.3.23



범례

*NO



시료채취

부지경계선

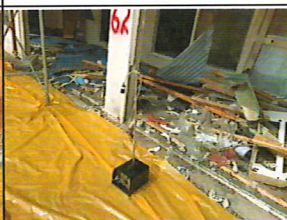
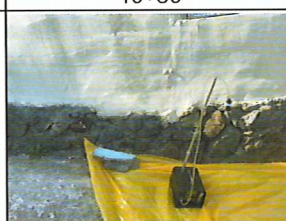
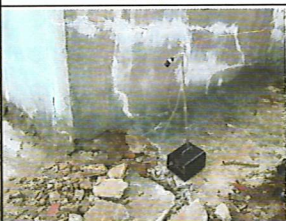
대상건축물

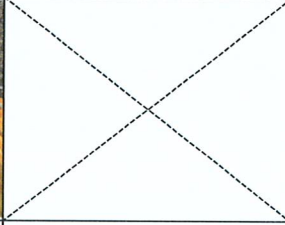
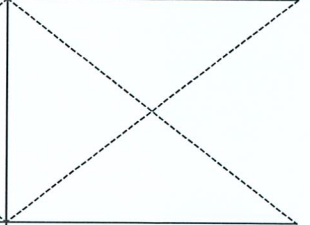
[별첨2] 측정 결과

시료 번호	측정 지점	측정 장비 (종류/수량)	유량 (ℓ/분)	측정 일시	측정 결과 (f/cc)	비고	
*1	부지경계선1	지역시료채취펌프 SARA-5100	1	9.87	22/03/23	불검출[검출한계 0.002미만]	-
*2	부지경계선2	지역시료채취펌프 SARA-5100	1	9.84	22/03/23	불검출[검출한계 0.002미만]	-
*3	부지경계선3	지역시료채취펌프 SARA-5100	1	9.71	22/03/23	불검출[검출한계 0.002미만]	-
*4	부지경계선4	지역시료채취펌프 SARA-5100	1	9.81	22/03/23	불검출[검출한계 0.002미만]	-
*5	위생설비입구	지역시료채취펌프 SARA-5100	1	9.86	22/03/23	불검출[검출한계 0.002미만]	-
*6	작업장주변1	지역시료채취펌프 SARA-5100	1	9.63	22/03/23	불검출[검출한계 0.002미만]	-
*7	작업장주변2	지역시료채취펌프 SARA-5100	1	9.98	22/03/23	불검출[검출한계 0.002미만]	-
*8	작업장주변3	지역시료채취펌프 SARA-5100	1	9.76	22/03/23	불검출[검출한계 0.002미만]	-
*9	작업장주변4	지역시료채취펌프 SARA-5100	1	9.62	22/03/23	불검출[검출한계 0.002미만]	-
*10	거주자주거지역1	지역시료채취펌프 SARA-5100	1	9.58	22/03/23	불검출[검출한계 0.002미만]	-
*11	거주자주거지역2	지역시료채취펌프 SARA-5100	1	9.83	22/03/23	불검출[검출한계 0.002미만]	-
*12	폐기물반출구1	지역시료채취펌프 SARA-5100	1	9.96	22/03/23	불검출[검출한계 0.002미만]	-
*13	폐기물반출구2	지역시료채취펌프 SARA-5100	1	9.56	22/03/23	불검출[검출한계 0.002미만]	-
*14	폐기물반출구3	지역시료채취펌프 SARA-5100	1	9.51	22/03/23	불검출[검출한계 0.002미만]	-
*15	폐기물반출구4	지역시료채취펌프 SARA-5100	1	9.84	22/03/23	불검출[검출한계 0.002미만]	-
*16	폐기물보관지점1	지역시료채취펌프 SARA-5100	1	9.50	22/03/23	불검출[검출한계 0.002미만]	-
*17	폐기물보관지점2	지역시료채취펌프 SARA-5100	1	9.62	22/03/23	불검출[검출한계 0.002미만]	-
*18	폐기물보관지점3	지역시료채취펌프 SARA-5100	1	9.54	22/03/23	불검출[검출한계 0.002미만]	-
*19	폐기물보관지점4	지역시료채취펌프 SARA-5100	1	9.98	22/03/23	불검출[검출한계 0.002미만]	-
*20	폐기물보관지점5	지역시료채취펌프 SARA-5100	1	9.72	22/03/23	불검출[검출한계 0.002미만]	-

[illegible]

[별첨3] 측정 사진 (측정일시 22.3.23)

측정 지점	시작 사진	종료 사진	시작 사진	종료 사진
부지경계선 1,2				
	8:05	12:15	8:10	12:20
부지경계선 3,4				
	8:15	12:25	8:25	12:35
위생설비입구 / 작업장주변1				
	8:40	9:25	8:45	10:55
작업장주변 2,3				
	10:30	12:40	11:20	13:30
작업장주변4 / 거주자 주거지역1				
	13:50	16:00	10:00	12:10
거주자 주거지역2 / 폐기물반출구1				
	10:20	12:30	9:00	9:45

측정 지점	시작 사진	종료 사진	시작 사진	종료 사진
폐기물반출구 2,3				
	10:45	11:30	13:10	13:55
폐기물반출구4 / 폐기물 보관지점1				
	14:50	15:35	12:45	13:30
폐기물 보관지점2,3				
	12:48	13:33	12:55	13:40
폐기물 보관지점4,5				
	12:56	13:41	12:58	13:43
폐기물 보관지점6,7				
	14:30	15:15	14:40	15:25
폐기물 보관지점8				
	14:55	15:40	-	-

[별 첨1] 측정 위치도(측정 장소)

소제지구 택지개발공사 중 석면철거공사		측정일시	22.3.24
범례	*NO		
	시료채취	부지경계선	대상건축물

소제지구 택지개발공사 중 석면철거공사

측정일시

22.3.24



범 례

*NO

시료채
취



부지경계선

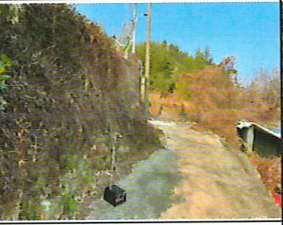
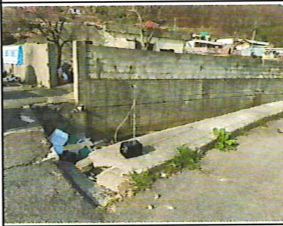
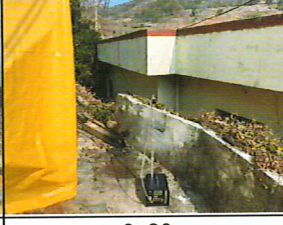
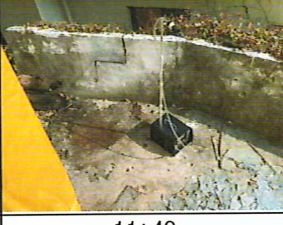
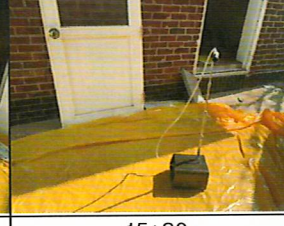


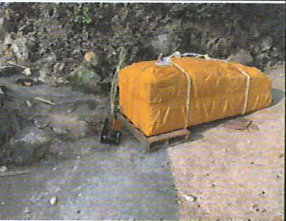
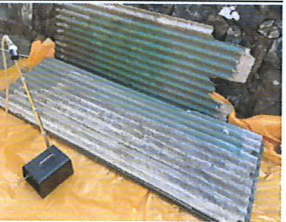
대상건축물

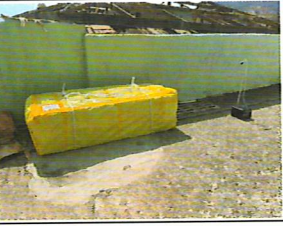
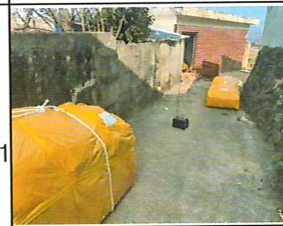
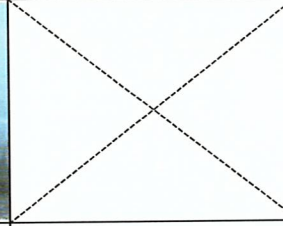
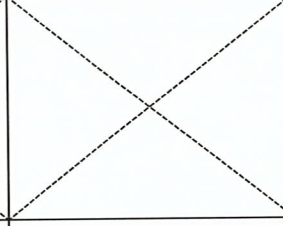
[별첨2] 측정 결과

시료 번호	측정 지점	측정 장비 (종류/수량)	유량 (ℓ/분)	측정 일시	측정 결과 (f/cc)	비고	
*1	부지경계선1	지역시료채취펌프 SARA-5100	1	9.67	22/03/24	불검출[검출한계 0.002미만]	-
*2	부지경계선2	지역시료채취펌프 SARA-5100	1	9.69	22/03/24	불검출[검출한계 0.002미만]	-
*3	부지경계선3	지역시료채취펌프 SARA-5100	1	9.86	22/03/24	불검출[검출한계 0.002미만]	-
*4	부지경계선4	지역시료채취펌프 SARA-5100	1	9.85	22/03/24	불검출[검출한계 0.002미만]	-
*5	위생설비입구	지역시료채취펌프 SARA-5100	1	9.84	22/03/24	불검출[검출한계 0.002미만]	-
*6	작업장주변1	지역시료채취펌프 SARA-5100	1	9.99	22/03/24	불검출[검출한계 0.002미만]	-
*7	작업장주변2	지역시료채취펌프 SARA-5100	1	9.73	22/03/24	불검출[검출한계 0.002미만]	-
*8	작업장주변3	지역시료채취펌프 SARA-5100	1	9.52	22/03/24	불검출[검출한계 0.002미만]	-
*9	작업장주변4	지역시료채취펌프 SARA-5100	1	9.77	22/03/24	불검출[검출한계 0.002미만]	-
*10	작업장주변5	지역시료채취펌프 SARA-5100	1	9.66	22/03/24	불검출[검출한계 0.002미만]	-
*11	작업장주변6	지역시료채취펌프 SARA-5100	1	9.81	22/03/24	불검출[검출한계 0.002미만]	-
*12	작업장주변7	지역시료채취펌프 SARA-5100	1	9.69	22/03/24	불검출[검출한계 0.002미만]	-
*13	작업장주변8	지역시료채취펌프 SARA-5100	1	9.83	22/03/24	불검출[검출한계 0.002미만]	-
*14	거주자주거지역1	지역시료채취펌프 SARA-5100	1	9.78	22/03/24	불검출[검출한계 0.002미만]	-
*15	거주자주거지역2	지역시료채취펌프 SARA-5100	1	9.64	22/03/24	불검출[검출한계 0.002미만]	-
*16	폐기물반출구1	지역시료채취펌프 SARA-5100	1	9.66	22/03/24	불검출[검출한계 0.002미만]	-
*17	폐기물반출구2	지역시료채취펌프 SARA-5100	1	9.84	22/03/24	불검출[검출한계 0.002미만]	-
*18	폐기물반출구3	지역시료채취펌프 SARA-5100	1	9.64	22/03/24	불검출[검출한계 0.002미만]	-
*19	폐기물반출구4	지역시료채취펌프 SARA-5100	1	9.85	22/03/24	불검출[검출한계 0.002미만]	-
*20	폐기물반출구5	지역시료채취펌프 SARA-5100	1	9.79	22/03/24	불검출[검출한계 0.002미만]	-

[별첨3] 측정 사진 (측정일시 22.3.23)

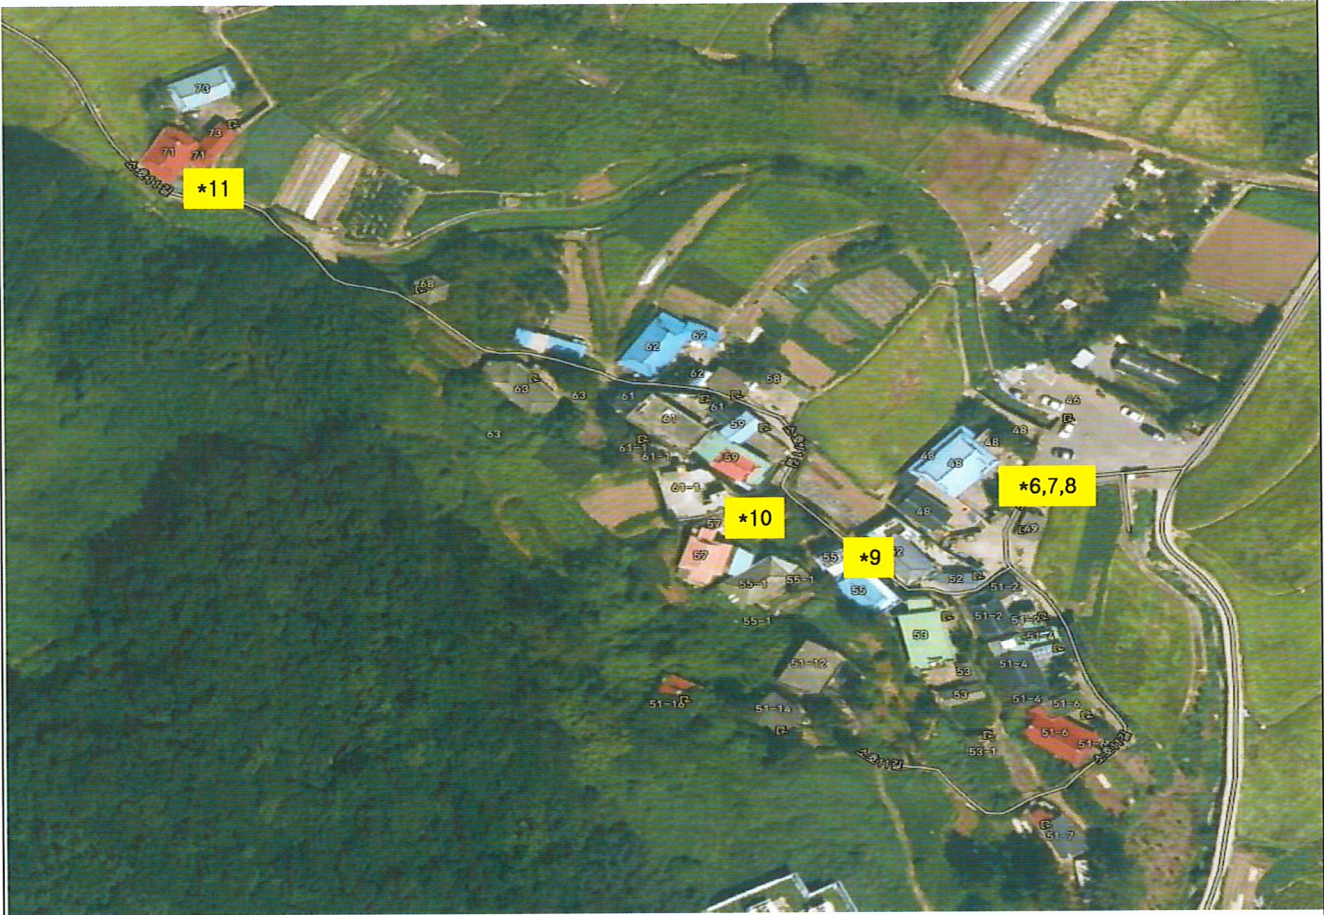
측정 지점	시작 사진	종료 사진	시작 사진	종료 사진
부지경계선 1,2				
	7:30	11:40	7:35	11:45
부지경계선 3,4				
	7:45	11:55	7:50	12:00
위생설비입구 / 작업장주변1				
	8:00	8:45	8:05	10:15
작업장주변 2,3				
	8:50	11:00	9:30	11:40
작업장주변4,5				
	10:30	12:40	12:50	15:00
작업장주변6,7				
	13:20	15:30	14:00	16:10

측정 지점	시작 사진	종료 사진	시작 사진	종료 사진
작업장주변8 / 거주자 주거지역1	 14:30	 16:40	 8:30	 10:40
거주자 주거지역2 / 폐기물반출구1	 8:40	 10:50	 8:10	 8:55
폐기물반출구 2,3	 8:55	 9:40	 9:35	 10:20
폐기물반출구 4,5	 11:00	 11:45	 13:05	 13:50
폐기물반출구 6,7	 13:40	 14:25	 15:30	 16:15
폐기물반출구8 / 폐기물 보관지점1	 16:45	 17:30	 12:20	 13:05

측정 지점	시작 사진	종료 사진	시작 사진	종료 사진
폐기물 보관지점2,3				
	12:23	13:08	12:30	13:15
폐기물 보관지점4,5				
	12:32	13:17	12:34	13:19
폐기물 보관지점6,7				
	14:40	15:25	14:42	15:27
폐기물 보관지점8,9				
	14:43	15:28	14:47	15:32
폐기물 보관지점10,11				
	14:50	15:35	14:55	15:40
폐기물 보관지점12				
	15:00	15:45	-	-

[별 첨1] 측정 위치도(측정 장소)

소제지구 택지개발공사 중 석면철거공사		측정일시	22.3.25
			
범례	*NO		
	시료채취	부지경계선	대상건축물



범 례

*NO



시료채취

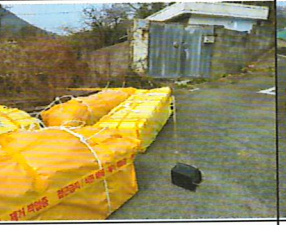
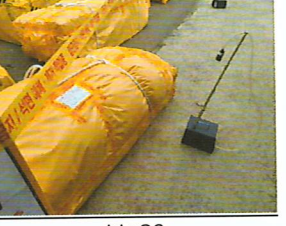
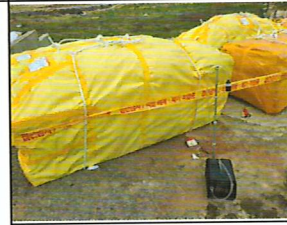
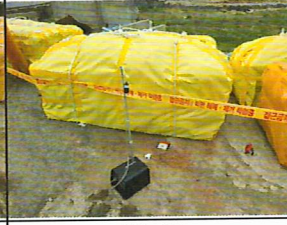
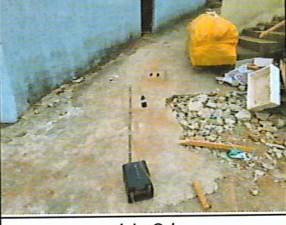
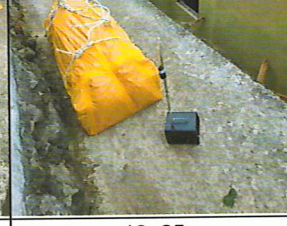
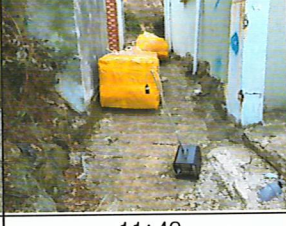
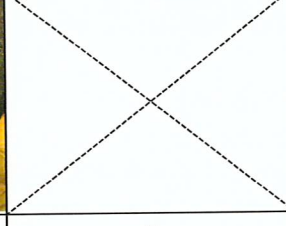
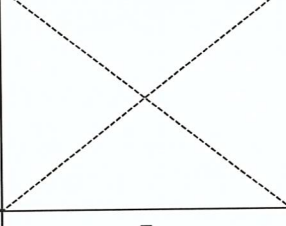
부지경계선

대상건축물

[별첨2] 측정 결과

시료 번호	측정 지점	측정 장비 (종류/수량)	유량 (ℓ/분)	측정 일시	측정 결과 (f/cc)	비고	
*1	폐기물보관지점1	지역시료채취펌프 SARA-5100	1	9.60	22/03/25	불검출[검출한계 0.002미만]	-
*2	폐기물보관지점2	지역시료채취펌프 SARA-5100	1	9.90	22/03/25	불검출[검출한계 0.002미만]	-
*3	폐기물보관지점3	지역시료채취펌프 SARA-5100	1	9.94	22/03/25	불검출[검출한계 0.002미만]	-
*4	폐기물보관지점4	지역시료채취펌프 SARA-5100	1	9.93	22/03/25	불검출[검출한계 0.002미만]	-
*5	폐기물보관지점5	지역시료채취펌프 SARA-5100	1	9.71	22/03/25	불검출[검출한계 0.002미만]	-
*6	폐기물보관지점6	지역시료채취펌프 SARA-5100	1	9.55	22/03/25	불검출[검출한계 0.002미만]	-
*7	폐기물보관지점7	지역시료채취펌프 SARA-5100	1	9.59	22/03/25	불검출[검출한계 0.002미만]	-
*8	폐기물보관지점8	지역시료채취펌프 SARA-5100	1	9.51	22/03/25	불검출[검출한계 0.002미만]	-
*9	폐기물보관지점9	지역시료채취펌프 SARA-5100	1	9.54	22/03/25	불검출[검출한계 0.002미만]	-
*10	폐기물보관지점10	지역시료채취펌프 SARA-5100	1	9.65	22/03/25	불검출[검출한계 0.002미만]	-
*11	폐기물보관지점11	지역시료채취펌프 SARA-5100	1	9.88	22/03/25	불검출[검출한계 0.002미만]	-
-	공시료	-	-	-	-	0개/100개시야	-
-	공시료	-	-	-	-	0개/100개시야	-

[별첨3] 측정 사진 (측정일시 22.3.23)

측정 지점	시작 사진	종료 사진	시작 사진	종료 사진
폐기물 보관지점 1,2	 10:30	 11:15	 10:31	 11:16
폐기물 보관지점 3,4	 10:40	 11:25	 10:41	 11:26
폐기물 보관지점 5,6	 10:45	 11:30	 11:30	 12:15
폐기물 보관지점 7,8	 11:30	 12:15	 11:31	 12:16
폐기물 보관지점 9,10	 11:40	 12:25	 11:42	 12:27
폐기물 보관지점 11	 11:45	 12:30	 -	 -